



Englisch / English

MIG/MAG welding machine

MIG/MAG-Schweißanlage

Kühltreiber

4100

Beratung ▪ Ersatzteile ▪ Kundenservice



Online-Shop

www.merkle-shop.de



Produktkatalog

www.merkle-muenchen.de/Merkle_Produkt_Katalog



Der führende Fachhandel
für Schweißen & Schneiden

MERKLE

München

Anton-Böck-Straße 31
81249 München
Tel. (089) 89 77 17 - 0
Fax (089) 89 77 17 - 99
info@merkle-muenchen.de
www.merkle-muenchen.de

Landshut

Meisenstraße 11 a
84030 Ergolding
Tel. (08 71) 9 33 17 - 0
Fax (08 71) 9 33 17 - 99
info@merkle-landshut.de
www.merkle-landshut.de

Rosenheim

Weidestraße 5 a
83024 Ro-Langenpfunzen
Tel. (0 80 31) 28 54 - 0
Fax (0 80 31) 28 54 - 99
info@merkle-rosenheim.de
www.merkle-rosenheim.de

Bestellformular



Der führende Fachhandel
für Schweißen & Schneiden

WILHELM MERKLE

Wilhelm Merkle
Schweißtechnik GmbH
Anton-Böck-Straße 31
81249 München-Freiham

info@merkle-muenchen.de

Fax 089 / 89 77 17 – 80

Absender

Sehr geehrte Damen und Herren,

hiermit bestellen wir wie folgt:

Menge	Bezeichnung	Sach-Nr.

Bitte rufen Sie mich an, ich habe Fragen.

Tel. _____

Ansprechpartner _____

München ▪ Landshut ▪ Rosenheim

Merkle München ein Unternehmen mit Zukunft!



Benjamin und Siegfried Awissus

Die Wilhelm Merkle Schweißtechnik GmbH wurde 1980 in München als Vertriebs- und Serviceniederlassung der Merkle-Schweißmaschinenbau GmbH aus Kötz in Schwaben gegründet, um von München aus die nieder- und oberbayerischen Kunden optimal zu betreuen. Da wir sehr schnell gewachsen sind, wurde 1985 eine Niederlassung bei Landshut gegründet, 1988 kam dann Rosenheim dazu, wodurch dann die optimalen Bedingungen geschaffen waren, um die Handwerks- und Industriekunden in München, Landshut und Rosenheim bestens zu betreuen.

Heute haben wir Werksvertretungen in der Tschechischen Republik, in Rumänien, in Serbien, in Kroatien und in Südtirol. Dadurch sind wir nun einer der größten schweißtechnischen Händler Bayerns. Durch den Umzug in unser eigenes Gebäude 2008 nach München-Freiham wurde unsere Expansion vorläufig abgeschlossen.

Unser Ziel war von Anfang an eine gesunde Mischung aus traditionellen Werten und innovativen Visionen, die uns dabei helfen, unsere Marktposition auch langfristig zu halten und weiter auszubauen. Wir verstehen uns als Problemlöser in allen Fragen rund um das Thema Schweißen und Schneiden. Es ist egal, ob es um ein spezielles schweißtechnisches Problem geht, ob Sie innerhalb von Stunden ein Mietgerät benötigen oder ob es um eine Express-Lieferung nach Bozen geht: Wir sind für Sie da und bieten entsprechende Lösungen an. Deshalb gehören Merkle, Innovation und Problemlösungen genauso unzertrennlich zusammen wie die ständige Weiterbildung und Schulung von Mitarbeitern und Kunden. Um dies auch für die Zukunft zu garantieren, bilden wir in unserem Unternehmen seit über 30 Jahren unseren Nachwuchs selbst aus.

Wir nehmen auch unsere soziale Verantwortung sehr ernst, indem wir seit 20 Jahren den Merkle-Cup sponsern, um Jugendlichen eine sinnvolle Freizeitbeschäftigung zu bieten. Das Turnier auf Bundesliga-Ebene ist inzwischen das zweitgrößte Jugend-Fußballturnier Deutschlands.



München



Landshut



Rosenheim

Unsere Philosophie war von Anfang an, dass wir stets Maßnahmen treffen und nur solche Ziele vor Augen haben, die auch in Zukunft eine stabile wirtschaftliche Basis garantieren. Da sich viele Kunden Gedanken über eine langfristige Zusammenarbeit mit ihren Lieferanten machen, versichern wir Ihnen, dass Merkle ein familiengeführtes Unternehmen ist und es auch bleiben wird, da auch die Nachfolge bereits gesichert ist. Wir können Ihnen garantieren, dass wir ein Team mit klaren und nachvollziehbaren Vorstellungen und Zielen sind, das sich seiner Verantwortung bewusst ist - heute und auch morgen, wodurch der Ausspruch "Einmal Merkle - immer Merkle" auch in kommenden Zeiten noch Gültigkeit und Bestand haben wird, denn Zukunft braucht Herkunft. Tradition und Zukunft sind kein Widerspruch, sie ergänzen sich.

In diesem Sinne hoffen wir weiterhin auf Ihre Treue und Verbundenheit, bleiben Sie uns auch weiterhin gewogen.

Siegfried Awissus
- Geschäftsführer -



Lange Öffnungszeiten

Montag bis Freitag:

München

6:30-12:00 Uhr u. 13:00-18:00 Uhr

Landshut

7:00-12:00 Uhr u. 13:00-17:30 Uhr

Rosenheim

7:00-12:00 Uhr u. 13:00-17:30 Uhr

München auch Samstag von

8:00-12:00 Uhr



Lieferservice

Auf Wunsch liefern wir die bestellte Ware auch direkt zu Ihnen nach Hause.



Herstellervorteil

Schweißanlagen sowie erwerben Sie bei uns direkt vom Hersteller zu besten Konditionen.



Getränke

Während Ihres Besuches steht Ihnen eine Auswahl an Getränken kostenlos zur Verfügung.



Parkplatz

Nutzen Sie den kostenlosen Parkplatz direkt vor der Tür.



Online-Shop

Hier können Sie nicht nur eine Vielzahl unserer Produkte rund um die Uhr bestellen, sondern auch eine Vielzahl von Infos abrufen.

www.merkle-shop.de



24 Stunden Notdienst

Wir sind zu jeder Tages- und Nachtzeit gegen einen geringen Aufschlag für Sie da.
Tel. (089) 89 77 17 - 0



Schweißkurse

Wir bieten MIG/MAG-, WIG- und Elektroden-Schweißkurse für Einsteiger, Hobbybastler und auch für absolute Profis an. Nähere Infos, wie Termine und freie Plätze, finden Sie unter www.schweisskurse-merkle.de



Gebrauchtanlagen

Suchen Sie eine besonders günstige Gebrauchtanlage?
Eine große Auswahl verschiedenster Modelle finden Sie unter www.gebrauchte-schweissgeraete.de



Mietanlagen

Wir vermieten so gut wie jede Schweiß- und Schneidanlage.
Eine Übersicht aller Anlagen und Preise finden Sie unter www.schweissgeraete-mieten.de



Reparaturen

Wir reparieren defekte Anlagen aller Fabrikate und führen auch die gesetzlich vorgeschriebenen Prüfungen nach EN/IEC 60 974-4 durch, entweder in unserer Werkstatt oder auch in Ihrem Betrieb. Außerdem kümmern wir uns um die jährlich vorgeschriebene Kalibrierung nach EN 1090.



Vorfürhrungen

Sie können jedes Gerät ausgiebig testen, entweder in unserem Vorführraum oder bei Ihnen zu Hause. Unser kompetentes Fachpersonal berät Sie gern und hilft Ihnen bei allen Fragen.



Finanzierung

Alle unsere Anlagen können Sie bei uns einfach und unkompliziert direkt finanzieren.



Social Media

Besuchen Sie uns auf Facebook, Instagram, Twitter und YouTube und entdecken Sie aktuelle News, Fotos, Events und vieles mehr.

Für die folgenden Schweißkurse gibt es absolut keine Voraussetzungen, deshalb kann sie wirklich jeder belegen, der Interesse am Thema Schweißen hat und am Ende eines Kurses einfache Teile zur Verwendung im Privatbereich herstellen möchte. Auch das Alter spielt dabei keine Rolle. Diese Einsteiger-Schweißkurse berechtigen nicht dazu, Schweißarbeiten auszuführen, für die eine Prüfung notwendig ist. Die Teilnahme wird durch ein Zertifikat nur bestätigt, es wird also kein Prüfzeugnis ausgestellt. Ihre persönliche Schutzausrüstung bitte mitbringen, falls nicht vorhanden, wird diese von uns vor Ort zur Verfügung gestellt. Die maximale Teilnehmerzahl ist bei allen Kursen auf 8 Personen begrenzt.

MAG-Schweißkurs

WIG-Schweißkurs

E-Schweißkurs

Autogen-Schweißkurs

Termine

Freitag oder Samstag von 8.00 - ca. 16.00 Uhr, also ca. 8 Stunden

Umfang

Theorie, Praxis, Getränke, Mittagessen, Schulungsmappe

WIG-Alu-Aufbau-Schweißkurs

Voraussetzung ist die Teilnahme an einem WIG-Einsteiger-Schweißkurs bei uns.

Besonders eingegangen wird bei diesem Kurs auf folgende Punkte:

- Einblicke in die Aluminiumarten
- Praktische Übungen an Kehl- und Stumpfnähten

Termine

Freitag oder Samstag von 8.00 - ca. 16.00 Uhr, also ca. 8 Stunden

Umfang

Theorie, Praxis, Getränke, Mittagessen, Schulungsmappe

TÜV-zertifizierter Wochen-Schweißkurs

Der Grundkurs dauert 1 Woche, wobei die Dauer maßgeblich vom Können und der Fähigkeit des Teilnehmers bestimmt ist, d.h., dass die Prüfung ggf. wiederholt werden muss. Auch hier sind keinerlei Voraussetzungen nötig, handwerkliche Fähigkeiten sind selbstverständlich eindeutig von Vorteil. Dieser Kurs wird durch eine bestandene Prüfung nachgewiesen und berechtigt zum Schweißen von abnahmepflichtigen Bauteilen im geregelten Bereich. Außerdem ist dieser Kurs mit bestandener Prüfung Voraussetzung für Arbeiten nach EN ISO 1090, die gängigsten Schweißnähte sind Kehl- und Stumpfnäht.

Angeboten wird dieser Kurs für das MAG- und WIG-Schweißverfahren.

Termine

Montag - Freitag von 8.00 - ca. 16.00 Uhr, insgesamt 5 Werktage

Umfang

Theorie, Praxis, Getränke, Mittagessen, Schulungsmappe, TÜV-Prüfung

IHR VORTEIL

Wenn Sie spätestens 2 Monate nach einem absolvierten Schweißkurs eine Neu- oder Gebrauchtanlage mit einem Rechnungsbetrag von mindestens 1.250,- Euro direkt bei uns in München, Landshut oder Rosenheim kaufen, erhalten Sie einen Nachlass in Höhe von 25 % auf den Schweißkurspreis, jedoch nur pro Anlage für eine Person und nur wenn der Schweißkurs in München absolviert wurde.

Sie können sich den Nachlass von 25% auch dadurch sichern, indem Sie den Schweißkurs sofort beim Kauf einer Neu- oder Gebrauchtanlage buchen.

Hiervon ausgenommen sind die Wochen-Schweißkurse mit anschließender TÜV-Prüfung.

Was ist MIG/MAG-Schweißen?

Die Schweißanlage besteht aus Schweißstromquelle, Drahtfördereinrichtung, Schutzgasversorgung, Steuereinheit und Schweißbrenner. Schweißstrom, Schutzgas und eine Drahtelektrode als Schweißzusatz werden dem Schweißbrenner durch das Schlauchpaket zugeführt. Im Stromkontaktrohr des Schweißbrenners wird der Schweißstrom über Gleitkontakt in die Drahtelektrode geleitet. Zwischen Elektrode und Werkstück entsteht ein sichtbar brennender Lichtbogen. Die Drahtelektrode schmilzt tropfenförmig ab. Diese kann mit einer hohen Stromstärke belastet werden, da der Schweißstrom unmittelbar vor dem Lichtbogen zugeführt wird, z. B. eine Drahtelektrode mit 1,0 mm Durchmesser und einer Strombelastbarkeit von 40 bis 220 A. Dies ermöglicht eine fehlerfreie und wirtschaftliche Verbindung von dünnen sowie dicken Querschnitten. Inerte Schutzgase schützen das Schweißbad beim Schweißen von Nichteisenmetallen vor Luftzutritt. Diesen Prozess nennt man Metall-Inertgasschweißen (MIG). Bei unlegierten und legierten Stählen schweißt man mit aktiven Schutzgasen, dies nennt man Metall-Aktivgasschweißen (MAG)

Anwendungsbereiche

- Unlegierte und legierte Stähle (MAG)
- Aluminium und andere Nichteisenmetalle (MIG)
- anwendbar in allen Positionen
- an Bauteilen mit Dicken zwischen 0,6 und 100 mm
- Kraftfahrzeugherstellung und -reparatur
- Stahlbau
- Metallbau
- Maschinenbau
- Apparatebau

- 1 → Netzanschlussleitung
2 → Schweißstromquelle
3 → Drahtelektrodenspule
4 → Schutzgasflasche mit Druckminderer
5 → Schutzgasschlauch
6 → Schlauchpaket
7 → Massekabel
8 → Werkstückklemme
9 → Schweißbrenner
10 → Lichtbogen



Typische Schweißdaten

Drahtelektrode	0,8 - 1,0 - 1,2 - 1,6 mm Ø Drahtfördergeschwindigkeit bis 30 m/min
Schweißstromstärke	bis 460 Ampere bei 1,6 mm Drahtelektrorendurchmesser, Gleich- oder Wechselstrom
Abschmelzleistung	bis 7 kg/h

Schutzgas-Drahtelektrode zum Schweißen von unlegierten Werkstoffen

Qualität G3Si1 (SG 2)

nach EN ISO 14341-A **G3Si1**
TÜV-, DB-Zulassung, CE-Zeichen

Für MAG-Schweißungen an unlegierten oder niedriglegierten
Stählen im Maschinen-, Stahl-, Behälter- und Schiffsbau.

Universelle Massivdraht-Elektrode für CO₂- oder Mischgas-
Schweißungen

Richtanalyse in %

C	Si	Mn
0,08	0,9	1,4

Für Werkstoffe:

allgemeine Baustähle	S235JR - S355JR (St 37 - St 55)
Feinkornbaustahl	S275N - S420N (StE 285 - StE 420)
Kesselstahl	P235GH - P355GH (H I - 19 Mn 6)
Schiffsbaustahl	(A - E)
Stromart	= (+)
Schweißpositionen	PH (w), PB (h), PF (s), PC (q), PE (ü)
Schutzgas nach EN ISO 14175	M 21 (15-25 % CO ₂ , Rest Argon), C 1 (100 % CO ₂)

Drahtelektrode:

Drahtdurchmesser	Spule	Gewicht
0,6 mm	D-100, normal	1 kg
0,8 mm	D-100, normal	1 kg
0,6 mm	D-200, normal	5 kg
0,8 mm	D-200, normal	5 kg
1,0 mm	D-200, normal	5 kg
0,6 mm	D-300, normal	15 kg
0,8 mm	D-300, lagen	5 kg
0,8 mm	D-300, lagen	15 kg
0,8 mm	K-300, lagen	15 kg
1,0 mm	K-300, lagen	15 kg
1,2 mm	K-300, lagen	15 kg

Sach-Nummer



JETZT im Shop bestellen
www.merkle-shop.de

n080.5.2203

n080.5.2208

n080.5.2205

n080.5.2210

n080.5.2220

n080.5.2206

n080.5.2215

n080.6.0211

n080.6.0111

n080.6.0121

n080.6.0131

Sach-Nummer

**Schutzgas-Drahtelektrode speziell zum Schweißen
von **Werkstoffen, die noch feuerverzinkt werden sollen****

Qualität G2Si1 (SG 1)

nach EN ISO 14341-A G2Si1
Zulassungsumfang bitte anfordern!

Für MAG-Schweißungen an unlegierten oder niedriglegierten
Stählen im Maschinen-, Stahl-, Behälter- und Schiffsbau.

Universelle Massivdraht-Elektrode für CO₂- oder Mischgas-
Schweißungen

Richtanalyse in %

C	Si	Mn
0,1	0,6	1,2

Für Werkstoffe:

allgemeine Baustähle	S235JR - S355JR (St 37 - St 55)
Feinkornbaustahl	S275N - S460N (StE 255 - StE 460)
Kesselstahl	P235GH - P355GH (H I -19 Mn 6)
Schiffsbaustahl	(A - E)
Stromart	= (+)
Schweißpositionen	PH (w), PB (h), PF (s), PC (q), PE (ü)
Schutzgas nach EN ISO 14175	M 21 (15-25 % Co ₂ , Rest Argon), C 1 (100 % Co ₂)

Drahtelektrode:

Drahtdurchmesser in	Spule	Gewicht
0,8 mm	K-300, lagen	15 kg
1,0 mm	K-300, lagen	15 kg
1,2 mm	K-300, lagen	15 kg
1,6 mm	K-300, lagen	15 kg



JETZT im Shop bestellen
www.merkle-shop.de

n080.5.3711

n080.5.3721

n080.5.3731

n080.5.3751

Sach-Nummer

**Schutzgas-Drahtelektrode speziell
zum Schweißen von bereits **verzinkten**
und **rostigen Blechen****

Qualität G2Ti

nach EN ISO 14341-A G2Ti

Schweißdraht für verzinkte und rostige Bleche sowie zum
Überschweißen von Fertigungsanstrichen (Primern). Her-
vorragende Verschweißbarkeit und gleichmäßige und glatte
Oberfläche der Schweißraupe.

Richtanalyse in %

C	Si	Mn	Al	Ti	Zr
0,06	0,5	1,1	0,1	0,1	0,1

Für Werkstoffe:

allgemeine Baustähle	S235JR - S355JR (St 37 - St 52)
Feinkornbaustahl	S275N - S420N (St 255 - StE 420)
Kesselstahl	P235GH - P355GH (H I bis 19 Mn 6)
Schutzgas nach EN ISO 14175	M 21 (15 - 25 % CO ₂ , Rest Argon), C 1 (100 % CO ₂)

Drahtelektrode:

Drahtdurchmesser	Spule	Gewicht
0,8 mm	K-300, lagen	15 kg
1,0 mm	K-300, lagen	15 kg
1,2 mm	K-300, lagen	15 kg



JETZT im Shop bestellen
www.merkle-shop.de

n080.5.3611

n080.5.3621

n080.5.3631

Sach-Nummer

n672.1.0000



Eine Kooperation mit
www.oldtimer-tv.com

DVD „Grundlagen des MIG/MAG-Schweißens“

Mit dieser DVD kann der Anfänger die wichtigsten Techniken erlernen und der fortgeschrittene Schweißer in der Werkstatt seine Kenntnisse um den ein oder anderen Kniff erweitern. Schweißprofis entwickelten außerdem Übungen, mit denen Fehler analysiert und eliminiert werden können. Anhand von detaillierten Fehleranalysen und der eingehenden Erklärung, welches Ergebnis auf Grund welcher Ausgangssituation entsteht, ist die Kunst des Schweißens verständlich und nachvollziehbar von Experten aufbereitet worden.

Beantwortung häufiger Fragen, wie:

- „Worauf ist zu achten, wenn man eine Kehlnaht oder eine Steignaht schweißt?“
- „Wie tief dringen die einzelnen Schweißtechniken ins Metall ein?“

Grundlegende Themen, wie:

- die richtige Brenner-Haltung
- Ermittlung der richtigen Einstellungen
- Erklärung der Nahtformen

n672.1.0005



DVD „Grundlagen des WIG-Schweißens“

Die Grundlagen des WIG-Schweißens, wie z.B. die Auswahl der richtigen Stromquelle, Spannung und Wolfram-Elektrode für die entsprechenden Metalle.

Erklärt werden die einzelnen Techniken wie die Stumpfnah, Kehlnaht und die Rund-Kehlnaht. Anhand von Grafiken und Detailaufnahmen können Fehler analysiert werden.

n67000664



Der Autor M. Briër ist seit vielen Jahren Schweißexperte, diplomierter WIG und MIG/MAG Schweißer und Schweißlehrer.

Buch: Schritt für Schritt MIG/MAG-Schweißen

Dieses Buch ist ein praktisches Handbuch mit vielen bebilderten Schritt für Schritt Beispielen, wertvollen Informationen und unverzichtbaren Praxistipps. Das Buch beschäftigt sich mit den grundlegenden Themen, wie beispielsweise der Ermittlung der richtigen Einstellungen, der richtigen Brennerhaltung, die einzelnen Schweißnahtformen und dem Dünnblechschweißen.

n67000665

Buch: Schritt für Schritt WIG-Schweißen

Dieses Buch ist ein praxisorientiertes Buch und hilft Ihnen, den WIG Schweißprozess in den Griff zu bekommen. WIG Schweißen wird von Profis ebenso wie von Hobbyschweißern eingesetzt, um Stahl, Edelstahl und Aluminium zu schweißen. In diesem WIG Lehrbuch finden Sie zahlreiche Informationen, praktische Tipps und über 200 Fotos zum vielseitigsten Schweißprozess der heutigen Zeit.

Contents

Introduction	22
Description	22
Technical data	22
Types of Machines	22
Usage limits	23
Safety standards	23
Installation	24
Equipment of welding machines	25
Connection to the electrical power supply	25
Control apparatus	25
Connection of the welding torch	26
Connection of the welding wire and adjustment of gas flow	27
Adjustment of welding parameters	27
Welding work cycles	30
Maintenance	31
The pointing out of any difficulties and their elimination	31
Ordering spare parts	31
Key to graphic symbols	54
Graphic symbols on the production plate	55
Recommended adjustment of welding parameters	56
Electrical diagram	61
List of spare parts	64
Spare parts of wire feeder and list of rolls	70
Trouble shooting list	73

Introduction

Thank you for purchasing one for our products.



Before using the equipment you should carefully read the instructions included in this manual.

In order to get the best performance from the system and ensure that its parts last as long as possible, you must strictly follow the usage instructions and the maintenance regulations included in this manual. In the interest of customers, you are recommended to have maintenance and, where necessary, repairs carried out by the workshops of our service organisation, since they have suitable equipment and specially trained personnel available. All our machinery and systems are subject to continual development. We must therefore reserve the right to modify their construction and properties.

Description

Machines 305, 309, 405, 3000, 3500 and 4100 are professional welding machines designed for MIG (Metal Inert Gas) and MAG (Metal Active Gas) welding. It is sources of welding current with flat characteristics. It concerns welding in protection atmosphere of active and intact gases when added material is in a form of „infinite“ wire supplied into the weld by the wire feeding. These methods are very productive, especially for the welds of construction steel, low steel, aluminium and its alloys.

The machines are designed as movable sets, differing from each other in their efficiency. The source of welding current, wire supply and feed are in one compact metal case with two fixed and two turning wheels.

Welding machines have been designed for welding of thin and thickness materials for wires used from 0.6 to 1.2 mm. Standard equipment of machines can be found in chapter „Equipment of welding machines“. Welding machines confirm to all European Union and Czech Republic standards and directives in force.

Types of Machines



Machines 305, 309, 405, 3000, 3500 and 4100 are delivered in the following designs:

Analogical type STANDARD

Easy and reliable control over machines. Operating is secured by one potentiometer of wire feed and two other potentiometers with a switch which controls switching on and setting spot and pulse functions. This type is supplied with a digital voltampermeter in a standard way (only 305, 405, 3500 and 4100).



Table 1

Technical data		305	309	405	3000	3500	4100
Mains voltage 50 Hz	V	3 x 400	3 x 400	3 x 400	3 x 400	3 x 400	3 x 400
Welding current range	A	30 - 280	30 - 250	30 - 350	30 - 250	30 - 280	50 - 350
Output voltage settings	V	17 - 38	17,7 - 39,2	18 - 40	17,7 - 39,2	19,2 - 41,9	22 - 51
Regulation steps		20	10	40	10	20	40
Duty cycle 30%	A	280	250	350	250 (45%)	280 (40%)	350 (35%)
Duty cycle 60%	A	260	200	300	210	270	280
Duty cycle 100%	A	220	170	260	190 (při 40°C)	235 (při 40°C)	240 (při 40°C)
Mains current/input 60%	A / kVA	12,3 / 8,6	9,5 / 6,6	15,3 / 10,6	9,6 / 7	14,8 / 10,6	17,3 / 12,8
Mains protection-slow, D	A	25	16	25	16	25	25
Winding		Cu	Cu / Al	Cu	Cu / Al	Cu / Al	Cu / Al
Wire feeder		2-roll	2-roll	4-roll	4-roll	4-roll	4-roll
Digital voltammeter		yes	only PROC.	yes	only PROC.	yes	yes
Standardly equipped roll		1,0-1,2	0,8-1,0	1,0-1,2	0,8-1,0	1,0-1,2	1,0-1,2
Wire feed speed		1-25 m/min STANDARD; 0,5-20 m/min PROCESSOR a SYNERGIC					
Diameter of wire - Fe		0,6-1,2	0,6-1,2	0,6-1,2	0,6-1,2	0,6-1,2	0,6-1,2
- Al		0,8-1,2	0,8-1,2	1,0-1,2	0,8-1,2	0,8-1,2	1,0-1,2
- Tube wire		0,8-1,2	-	0,8-1,2	0,8-1,2	0,8-1,2	0,8-1,2
Protection degree		IP 21S	IP 21S	IP 21S	IP 21S	IP 21S	IP 21S
Insulation class		F	F	F	F, H	F, H	F, H
Standards		EN 60974-1, EN 60974-5, EN 60974-10					
Dimensions LxWxH	mm	806x490x822	782x490x738	806x490x822	902x510x890	902x510x890	902x510x890
Weight	kg	93	68	101	75	88	94

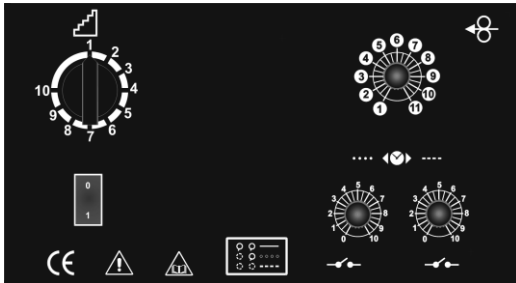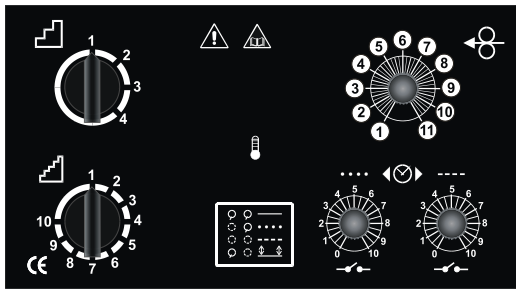


Digital type PROCESSOR

A simple solution of having control over all functions for MIG/MAG welding. Simple control and setting of all functions is secured by one potentiometer and two buttons. Function LOGIC also makes an easy control possible. Machines with this control are supplied with a digital voltampermeter with memory in a standard way. A simple solution of having control allows setting values of pre-gas and post-gas, function SOFT START, burning out of wire, spot and pulse welding. Regulation allows setting two-time and four-time modes. Easy advanced feeding of wire to wire feeder. Electronic regulation of speed of wire feed manages feedback regulation of wire feed which secures constant set speed of wire shifting.

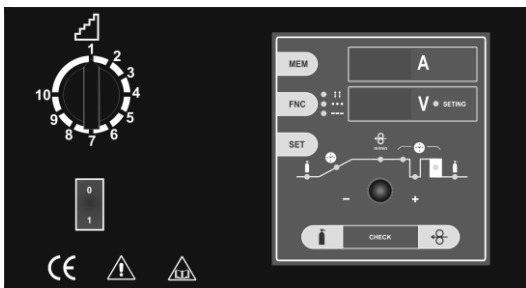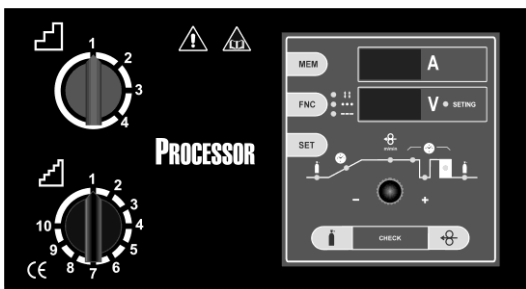

Synergic type (except 3000, 3500, 4100)

It significantly makes setting of welding parameters possible. An operator sets up the type of a program by using easy setting of diameter of welding wire and used protective gas. Then you can simply set up voltage when you use the switch and control unit Synergic chooses the best parameters of speed of wire feed. Simple operating and setting of all functions is secured by one potentiometer and two buttons. Function LOGIC also makes an easy control possible. Machines with this control are supplied with a digital voltampermeter with memory in a standard way. A simple solution of having control allows setting values of pre-gas and post-gas, function SOFT START, burning out of wire, spot and pulse welding. Regulation allows setting two-time and four-time modes. Easy advanced feeding of wire to wire feeder. Electronic regulation of speed of wire feed manages feedback regulation of wire feed which secures constant set speed of wire shifting.

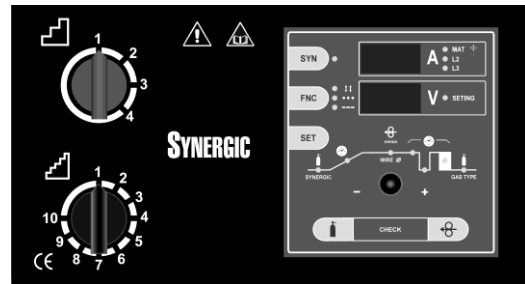

Usage limits

(EN 60974-1)

The use of a welder is typically discontinuous, in that it is made up of effective work periods (welding) and rest periods (for the positioning of parts, the replacement of wire and underflushing operations etc. This welders are dimensioned to supply a 280 A, 320 A and 350 A nominal current in complete safety for a period of work 30% or 35%, 40% of the total usage time.

The regulations in force establish the total usage time to be 10 minutes. The 20% work cycle is considered to be 2 minute of the ten-minute period of time. If the permitted work cycle time is exceeded, an overheat cut-off occurs to protect the components around the welder from dangerous overheating. Intervention of the overheat cut-off is indicated by the lighting up of yellow thermostat signal light (pos. 4, picture 1 A). After several minutes the over-heat cut off rearms automatically (and the yellow signal light turns itself off) and the welder is ready for use again. Machines are constructed in compliance with the IP 21S protection level.

Safety standards

Welding machines must be used for welding and not for other improper uses. Never use the welding machines with its removed covers. By removing the cover's the cooling efficiency is reduced and the machine can be damaged. In this case the supplier does not take his responsibility for the damage incurred and for this reason you can't stake a claim for a guarantee repair. Their use is permitted only by trained and experienced persons. The operator must observe all safety standards in order to guarantee of self safety and that of third parties.

SAFETY INSTRUCTIONS FOR MACHINE OPERATORS

The operator is obliged to do the revision of operational safety of the device at least once in 12 months period. The same interval is recommended for welding machines calibration. Besides that, revision made by authorized inspection technician is prescribed also for these cases: after change, after reconstruction, repair, maintenance, etc. During these safety tests national and international regulations must be respected.

KEEP GENERAL FIREFIGHTING REGULATIONS!

Keep general firefighting regulations while respecting local specific conditions at the same time. Welding is always specified as an activity with the risk of a fire. **Welding in places with flammable or explosive materials is strictly forbidden.** There must always be fire extinguishers in the welding place.

ATTENTION! Sparks can cause an ignition many hours after the welding has been finished, especially in unapproachable places. After welding has been finished, let the machine cool down for at least ten minutes. If the machine has not been cooled down, there is a high increase of temperature inside, which can damage power elements.

SECURITY OF WORK WHILE WELDING OF METALS CONTAINING LEAD, CADMIUM, ZINK, MERCURY AND GLUCINUM

- Make specific precautions if you weld materials containing these metals.
- Do not carry out welding processes on gas, oil, fuel etc. tanks (even empty ones) because there is **the risk of an explosion. Welding can be carried out only according to specific regulations!!!**
- **In spaces with the risk of an explosion there are specific regulations valid.**

PREVENTION FROM ELECTRICAL CURRENT INJURY

- Do not carry out repairs with the generator live.
- Before carrying out any maintenance or repair activities, disconnect the machine from the mains.
- Ensure that the welder is suitably earthed.
- The equipment must be installed and run by qualified personnel.
- All connections must comply with the regulations in force (EN 60974-1) and with the accident prevention laws.
- Do not weld with worn or loose wires. Inspect all cables frequently and ensure that there are no insulation defects, uncovered wires or loose connections.
- Do not weld with cables of insufficient diameter and stop soldering if the cables overheat, so as to avoid rapid deterioration of the insulation.



- Never directly touch live parts. After use, carefully replace the torch or the electrode holding grippers, avoiding contact with the parts connected to earth.

SAFETY REGARDING WELDING FUMES AND GAS

- Carry out purification of the work area, from gas and fumes emitted during the welding, especially when welding is carried out in an enclosed space.
- Place the welding system in a well aired place.
- Remove any traces of varnish that cover the parts to be welded, in order to avoid toxic gases being released. Always air the work area.
- Don't weld in places where gas leaks are suspected or close to internal combustion engines.
- Keep the welding equipment away from baths for the removal of grease where vapours of trichlorethylene or other chlorine containing hydrocarbons are used as solvents, as the welding arc and the ultraviolet radiation produced by it react with such vapours to form phosgene, a highly toxic gas.



PROTECTION FROM RADIATION, BURNS AND NOISE

- Never use broken or defective protection masks.
- Do not look at the welding arc without a suitable protective shield or helmet.
- Protect your eyes with a special screen fitted with adiacinic glass (protection grade 9-14 EN 169).
- Immediately replace unsuitable adiacinic glass.
- Place transparent glass in front of the adiacinic glass to protect it.
- Do not trigger off the welding arc before you are sure that all nearby people are equipped with suitable protection.
- Pay attention that the eyes of nearby persons are not damaged by the ultraviolet rays produced by the welding arc.
- Always use protective overalls, splinterproof glasses and gloves.
- Wear protective earphones or earplugs.
- Wear leather gloves in order to avoid burns and abrasions while manipulating the pieces.



ATTENTION, REVOLVING GEARING

- Wire shift must be handled very carefully, only if the machine is switched off.
- While manipulating with the shift, never use protection gloves, there is a danger of catching in the gearing.



AVOIDANCE OF FLAMES AND EXPLOSIONS

- Remove all combustibles from the workplace.
- Do not weld close to inflammable materials or liquids, or in environments saturated with explosive gasses.
- Do not wear clothing impregnated with oil and grease, as sparks can trigger off flames.
- Do not weld on recipients that have contained inflammable substances, or on materials that can generate toxic and inflammable vapours when heated.
- Do not weld a recipient without first determining what it has contained. Even small traces of an inflammable gas or liquid can cause an explosion.
- Never use oxygen to degas a container.
- Avoid gasbrazing with wide cavities that have not been properly degassed.
- Keep a fire extinguisher close to the workplace.
- Never use oxygen in a welding torch; use only inert gases or mixtures of these.



RISKS DUE TO ELECTROMAGNETIC FIELDS

- The magnetic field generated by the machine can be dangerous to people fitted with pacemakers, hearing aids and similar equipment. Such people must consult their doctor before going near a machine in operation.
- Do not go near a machine in operation with watches, magnetic data supports and timers etc. These articles may suffer irreparable damage due to the magnetic field.
- This equipment complies with the set protection requirements and directives on electromagnetic compatibility (EMC). Welding machines in terms of interference suppression are determined for industrial space. It is



assumed that their wide use in all industrial area, but it is not for using at home! In particular, it complies with the technical prescriptions of the EN 60974-10 standard and is foreseen to be used in all industrial spaces and not in spaces for domestic use. If electromagnetic disturbances should occur, it is the user's responsibility to resolve the situation with the technical assistance of the producer. In some cases the remedy is to schormare the welder and introduce suitable filters into the supply line.

WARNING:

This inclusion is not made for using in residential premises where is electrical energy supplied by low-voltage system. Here can be some problems with ensuring electromagnetic compatibility in these premises caused by interference spread wiring the same as radiate interference..

MATERIALS AND DISPOSAL

- These machines are build from materials that do not contain substances which are toxic or poisonous to the operator.
- During the disposal phase the machine should be disassembled and its components should be separated according to the type of material they are made from.



DISPOSAL OF USED MACHINERY

- Collecting places/banks designed for back withdrawer should be used for disposal of machinery put out of the operation.
- Don't throw away machinery into common waste and apply the procedure mentioned above.



HANDLING AND STOCKING COMPRESSED GASES

- Always avoid contact between cables carrying welding current and compressed gases cylinder and their storage systems.
- Always close the valves on the compressed gas cylinders when not in use.
- The valves on inert gas cylinder should always be fully opened when in use.
- The valves on flammable gases should only be opened full turn so that quick shut off can be made in an emergency.
- Care should be taken when moving compressed gas cylinders to avoid damage and accidents which could result in injury.
- Do not attempt to refill compressed gas cylinders, always use the correct pressure reduction regulators and suitable base fixed with the correct connectors.



PLACEMENT OF THE MACHINE

When choosing the position of the machine placement, be careful to prevent the machine from conducting impurities and getting them inside (for example flying particles from the grinding tool).

Installation

The installation site for the system must be carefully chosen in order to ensure its satisfactory and safe use. The user is responsible for the installation and use of the system in accordance with the producer's instructions contained in this manual. Before installing the system the user must take into consideration the potential electromagnetic problems in the work area. In particular, we suggest that you should avoid installing the system close to:

- signalling, control and telephone cables
- radio and television transmitters and receivers
- computers and control and measurement instruments
- security and protection instruments



Persons fitted with pacemakers, hearing aids and similar equipment must consult their doctor before going near a machine in operation. The equipment's installation environment must comply to the protection level of the frame i.e. IP 21S. The system is cooled by means of the forced circulation of air, and must therefore be placed in such a way that the air may be easily sucked in and expelled through the apertures made in the frame.

Table 2

	305	309	405	3000	3500	4100
I Max	280 A (30%)	250 A (30%)	350 A (30%)	250 A (45%)	280 A (40%)	350 A (35%)
Installed power	9,9 kVA	9,2 kVA	13,5 kVA	6,6 kW	7,8 kW	11 kW
Protection slow, char. D	25 A	16 A	25 A	16 A	25 A	25 A
Diameter of input connection	4 x 2,5 mm ²	4 x 2,5 mm ²	4 x 2,5 mm ²	4x2,5 mm ²	4x2,5 mm ²	4x2,5 mm ²
Earth cable-cut	35 mm ²	35 mm ²	70 mm ²	35 mm ²	35 mm ²	50 mm ²
Welding torch	KTB 25	KTB 25/36	KTB 36	KTB 25/36	KTB 25/36	KTB 36





Picture 1A

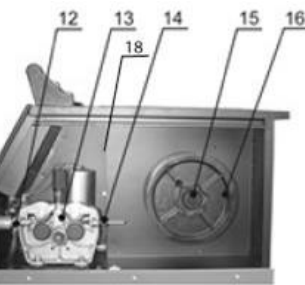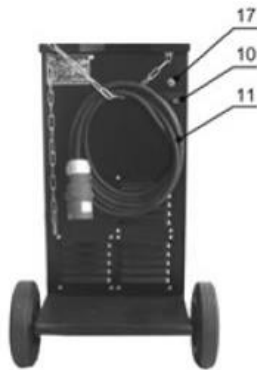

Picture 2A



Picture 1B

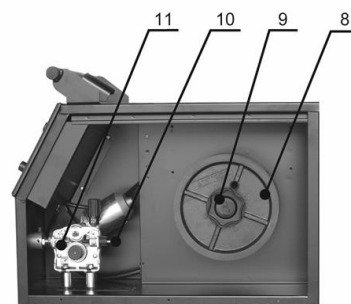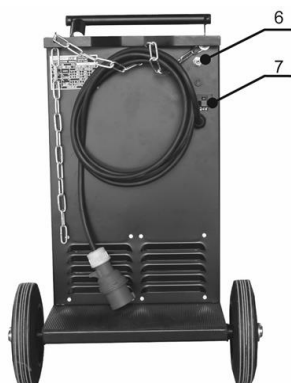

Picture 2B

Equipment of machines

Machines are also standardly equipped with:

- Earthing cable 3 m long with a grip.
- Hose for gas connection.
- Cable for gas heating connection.
- Roller for wire of 1.0 and 1.2 mm in diameter.
- Accompanying documentation.
- Reduction for wire 5 kg and 18 kg.
- Functions for two and four cycle time.
- Modes of spot welding and slow pulsing.
- Two or four roll wire feeder.

Special accessories for ordering:

- Welding torch 3, 4 or 5 m long.
- Cylinder pressure regulators for CO₂ or mixed gases of Argon.
- Spare rollers for wires different in diameter.
- Four roll wire feeder.
- Spare parts of welding torch.
- Earthing cable 4 m or 5 m long.

Connection to the electrical power supply

Before connecting the welder to the electrical supply check, that the machines plate rating corresponds to the supply voltage and frequency and that the line switch of the welder is in the position „0“.

Use original plug for machines to connect to power supply. Machines are designed for TN-C-S grid. It's provided with 5-pin plug. The middle line wire is not used. Eventual changing of plug can be made only by person with electrotechnical qualification. If you need to change the plug, follow this:

- connection to the power supply must be carried out using of four polar cable
- three conducting wires, it does not matter, what is the order of phases
- the fourth, yellow-green wire is used for making the „EARTH“ connection

Connect a suitable normalized plug to the power cable. Provide for an electrical socket complete with fuses or an automatic switch.

TABLE 2: Shows the recommended load values for retardant supply fuses chosen according to the maximum nominal current supplied to the welder and the nominal supply voltage.

NOTE 1: Any extensions to the power cable must be of a suitable diameter, and absolutely not of a smaller diameter than the special cable supplied with the machine.

NOTE 2: It is not advisable to plug up the welder to motordriven generators, as they are known to supply an unstable voltage.

Control apparatus

(305, 405)

PICTURE 1A

- Position 1** Supply switch. In the „O“ position the welder is off.
Position 2 10-positional voltage changeover switch.
Position 3 2- or 4- positional voltage changeover switch.
Position 4 Thermostat yellow signal light. When this light comes it means that the overheat cut-off has come on, because the work cycle limit has been exceeded. Wait for a few minutes before starting to weld again.
Position 5 Potentiometer of speed adjustment of the wire feed.
Position 6 Switch of spot welding function with potentiometer of adjustment of spot welding length.
Position 7 Switch of PAUSE function with potentiometer of adjustment of pause length between each spots - slow pulses.
Position 8 EURO connector of welding burner connection.
Position 9 Inductance connection L1 and L2.
Position 10 Terminal board of voltage supply for gas 42 V AC heating.
Position 11 Supply cable with connection.
Position 17 Automatic electromagnetic gas valve.
Position 18 Setting of potentiometers: (only 305, 405 machines Standard)

Pre-gas - setting the time of pre-gas before start of welding process.

Burning out - setting the time of burning out of wire after the welding process

Post-gas - setting the time of post-gas after the welding process

Wire let-out - the wire feed speed before ignition of the welding arc

PICTURE 2A

- Position 12** Loading tube of EURO connector.
Position 13 Wire feeder.
Position 14 Loading bowden.
Position 15 Wire spool holder with brake.
Position 16 Adaptor of wire spool.